


Mill

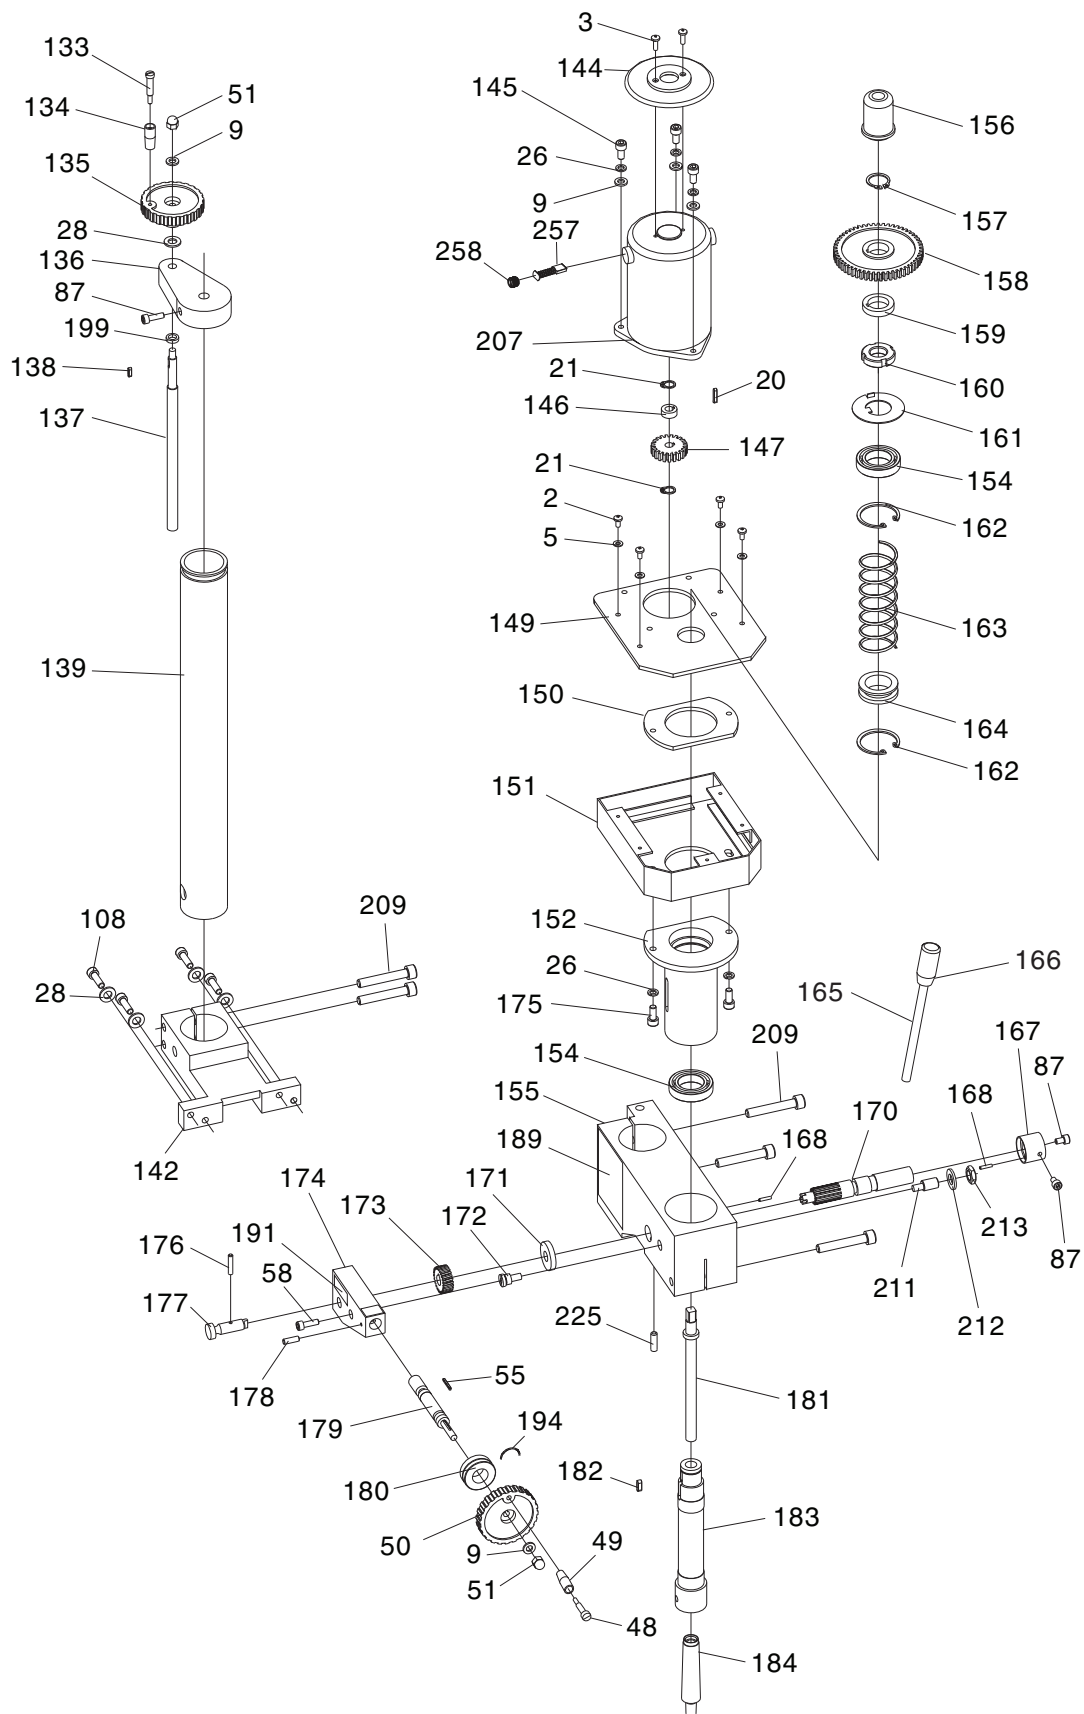

Mill Parts List

REF PART # DESCRIPTION


2	P0937002	PHLP HD SCR M4-.7 X 8
3	P0937003	PHLP HD SCR M4-.7 X 12
5	P0937005	FLAT WASHER 4MM
9	P0937009	FLAT WASHER 6MM
20	P0937020	KEY 3 X 3 X 16 RE
21	P0937021	EXT RETAINING RING 8MM
26	P0937026	LOCK WASHER 6MM
28	P0937028	FLAT WASHER 8MM
48	P0937048	SHOULDER SCREW M4-1 X 10, 4 X 31
49	P0937049	HOLLOW HANDLE 6 X 10, 25
50	P0937050	HANDWHEEL 58D X 6B-K, M4-1
51	P0937051	ACORN NUT M6-1
55	P0937055	KEY 2 X 2 X 10 RE
58	P0937058	CAP SCREW M5-.8 X 20
87	P0937087	CAP SCREW M5-.8 X 8
108	P0937108	CAP SCREW M8-1.25 X 40
133	P0937133	SHOULDER SCREW M6-1 X 8, 4.5 X 60.5
134	P0937134	HOLLOW HANDLE 44 X 15, 12
135	P0937135	HANDWHEEL 80D X 10B-K, M6-1
136	P0937136	LEADSCREW SUPPORT
137	P0937137	DRILL LEADSCREW
138	P0937138	KEY 3 X 3 X 10 RE
139	P0937139	COLUMN
142	P0937142	COLUMN SUPPORT
144	P0937144	MOTOR PROTECTION COVER
145	P0937145	CAP SCREW M6-1 X 14
146	P0937146	SPACER 8 X 15 X 12.5
147	P0937147	MOTOR GEAR 21T
149	P0937149	UPPER DRILL COVER
150	P0937150	MOTOR FIXED PLATE
151	P0937151	MAIN SHAFT CARRIAGE
152	P0937152	DRILL QUILL
154	P0937154	BALL BEARING 61905ZZ
155	P0937155	MILL HEADSTOCK
156	P0937156	SPINDLE COVER
157	P0937157	EXT RETAINING RING 20MM

REF PART # DESCRIPTION

158	P0937158	SPINDLE GEAR 55T
159	P0937159	SPACER 20.1 X 30 X 6
160	P0937160	SPINDLE NUT M24-1.5
161	P0937161	ELASTIC WASHER 24MM
162	P0937162	INT RETAINING RING 38MM
163	P0937163	COMPRESSION SPRING 1 X 37 X 115.3
164	P0937164	RING
165	P0937165	HANDLE SHAFT
166	P0937166	DOWNFEED KNOB, ROUND
167	P0937167	DEPTH SCALE SLEEVE
168	P0937168	ROLL PIN 3 X 12
170	P0937170	PINION GEAR 14T
171	P0937171	SPACER 10 X 28 X 5
172	P0937172	WORM SHAFT SCREW M10-1 X 5, 12 X 3
173	P0937173	GEAR 24T
174	P0937174	WORM SHAFT SUPPORT
175	P0937175	CAP SCREW M6-1 X 16
176	P0937176	CONNECT SHAFT PIN A3 X 12
177	P0937177	CONNECT PIN
178	P0937178	WORM SHAFT PIN A3 X 18
179	P0937179	WORM SHAFT
180	P0937180	FINE-FEED SCALE
181	P0937181	TENSION SHAFT
182	P0937182	KEY 4 X 4 X 12 RE
183	P0937183	SPINDLE
184	P0937184	CHUCK ARBOR
194	P0937194	SPRING 1 X 12
199	P0937199	SPACER 8 X 12 X 3
207	P0937207	MOTOR 1/4HP 110V 1-PH
209	P0937209	CAP SCREW M8-1.25 X 40
211	P0937211	ADJUSTING SCREW
212	P0937212	FLAT WASHER 10MM
213	P0937213	HEX NUT M8-1.25 THIN
225	P0937225	SET SCREW M6-1 X 20
257	P0937257	MILL CARBON BRUSH (2-PC SET)
258	P0937258	MILL CARBON BRUSH COVER



Lathe

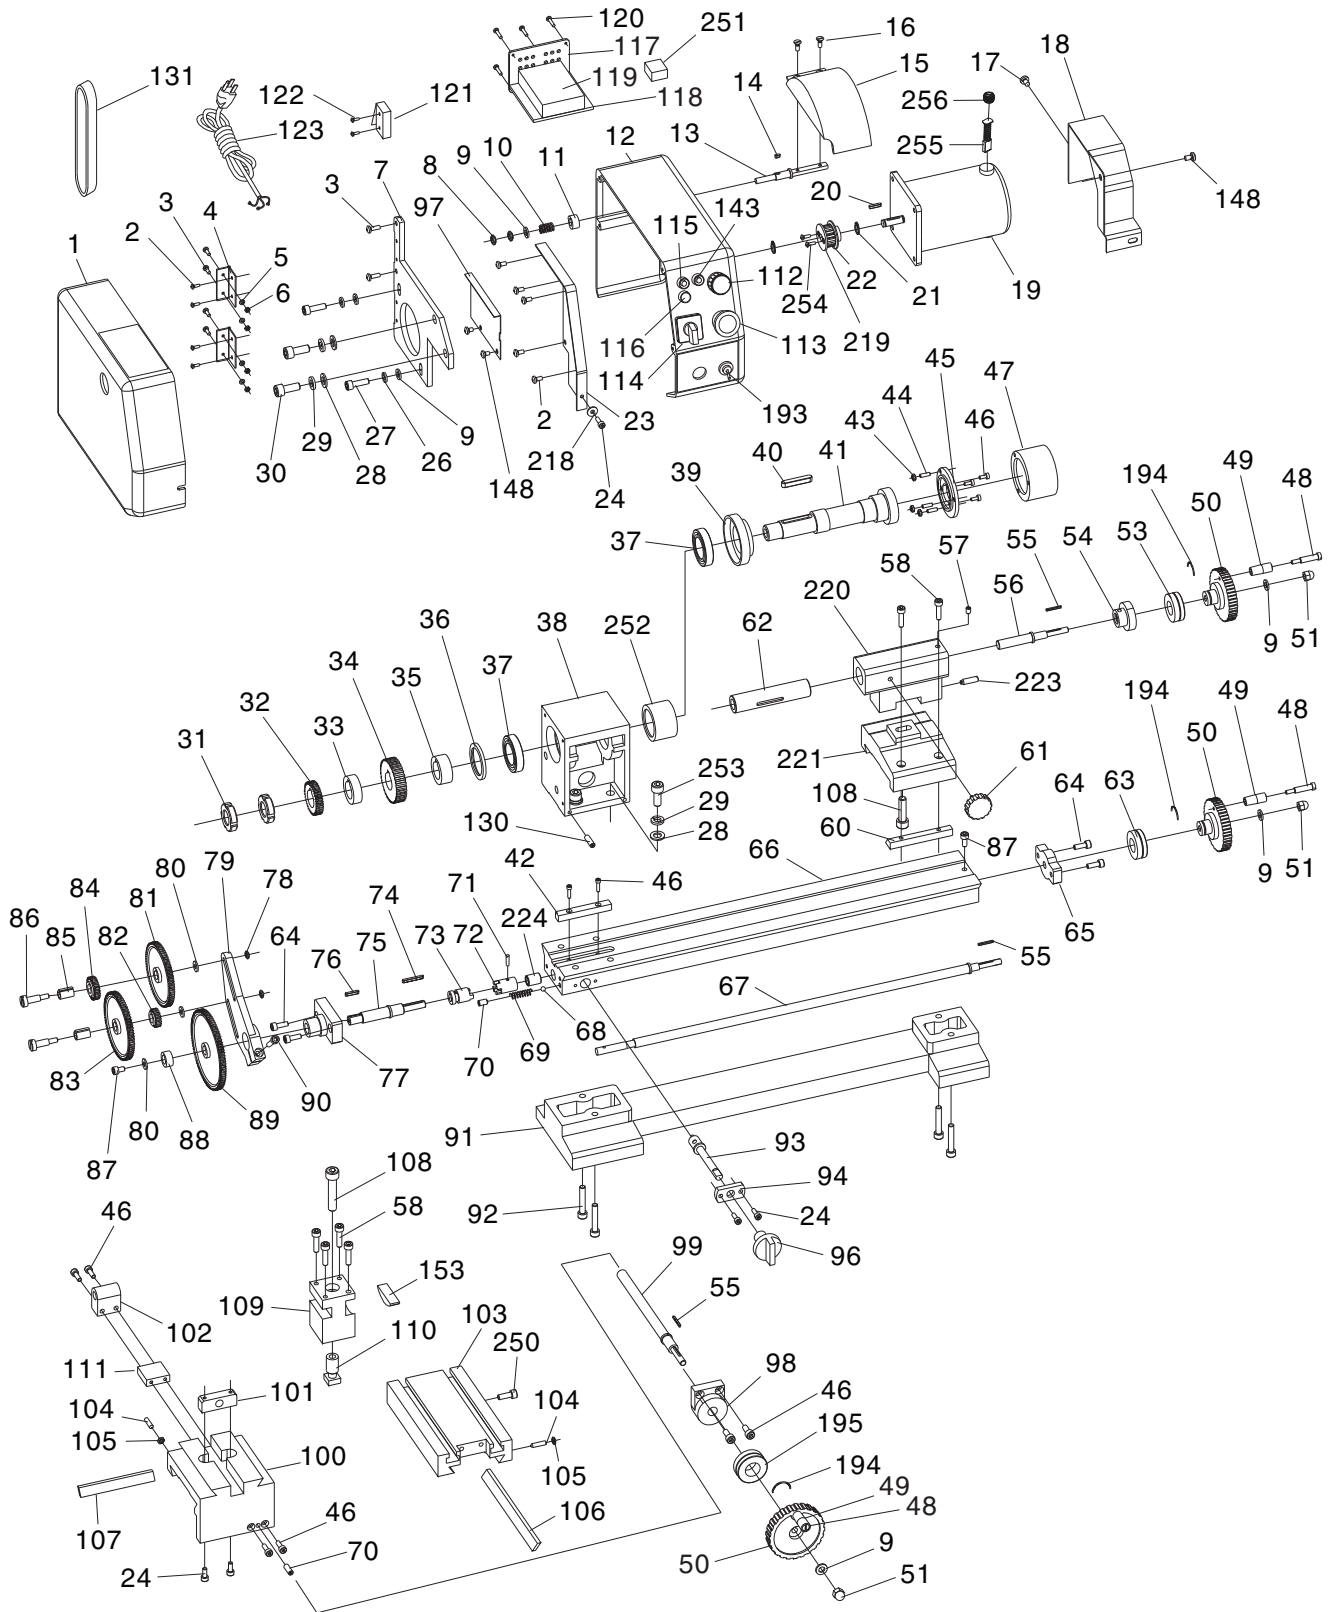

REF PART # DESCRIPTION

1	P0937001	END GEAR COVER
2	P0937002	PHLP HD SCR M4-.7 X 8
3	P0937003	PHLP HD SCR M4-.7 X 12
4	P0937004	GEAR COVER HINGE 38L X 31B
5	P0937005	FLAT WASHER 4MM
6	P0937006	HEX NUT M4-.7

REF PART # DESCRIPTION

7	P0937007	CANTILEVER BRACKET
8	P0937008	HEX NUT M6-1
9	P0937009	FLAT WASHER 6MM
10	P0937010	COMPRESSION SPRING 1 X 9.2 X 14
11	P0937011	SPACER 8 X 15 X 8
12	P0937012	SPINDLE BOX COVER




Lathe Parts List (Cont.)

REF	PART #	DESCRIPTION
13	P0937013	SPINDLE
14	P0937014	KEY 3 X 3 X 6 RE
15	P0937015	CHUCK GUARD
16	P0937016	CAP SCREW M4-.7 X 8
17	P0937017	CAP SCREW M5-.8 X 8
18	P0937018	REAR SPLASH GUARD
19	P0937019	MOTOR 1/4HP 110V 1-PH
20	P0937020	KEY 3 X 3 X 16 RE
21	P0937021	EXT RETAINING RING 8MM
22	P0937022	LATHE MOTOR PULLEY
23	P0937023	SUPPORT PLATE
24	P0937024	CAP SCREW M4-.7 X 10
26	P0937026	LOCK WASHER 6MM
27	P0937027	CAP SCREW M6-1 X 20
28	P0937028	FLAT WASHER 8MM
29	P0937029	LOCK WASHER 8MM
30	P0937030	CAP SCREW M8-1.25 X 20
31	P0937031	SPINDLE NUT M18-1.5
32	P0937032	SPINDLE GEAR 36T
33	P0937033	SPACER 20 X 32 X 10
34	P0937034	SPINDLE PULLEY
35	P0937035	SPACER 20 X 32 X 12.5
36	P0937036	OIL SEAL (REAR)
37	P0937037	TAPERED BEARING 30205
38	P0937038	SPINDLE BOX
39	P0937039	OIL SEAL (FRONT)
40	P0937040	KEY 6 X 6 X 36 RE
41	P0937041	SPINDLE
42	P0937042	BED KEY
43	P0937043	HEX NUT M6-1
44	P0937044	SET SCREW M6-1 X 25
45	P0937045	CHUCK FLANGE
46	P0937046	CAP SCREW M4-.7 X 12
47	P0937047	3-JAW CHUCK 80MM
48	P0937048	SHOULDER SCREW M4-1 X 10, 4 X 31
49	P0937049	HOLLOW HANDLE 6 X 10, 25
50	P0937050	HANDWHEEL 58D X 6B-K, M4-1
51	P0937051	ACORN NUT M6-1
53	P0937053	SPACER 16 X 32 X 12
54	P0937054	TAILSTOCK SCREW BASE
55	P0937055	KEY 2 X 2 X 10 RE
56	P0937056	TAILSTOCK SCREW
57	P0937057	SET SCREW M5-.8 X 8
58	P0937058	CAP SCREW M5-.8 X 20
60	P0937060	WEDGE
61	P0937061	KNOB BOLT M6-1 X 9, 14-LOBE, D27.5
62	P0937062	TAILSTOCK QUILL
63	P0937063	DIAL
64	P0937064	CAP SCREW M5-.8 X 14
65	P0937065	LEADSCREW BRACKET
66	P0937066	BED
67	P0937067	LEADSCREW
68	P0937068	STEEL BALL 5MM
69	P0937069	COMPRESSION SPRING 0.8 X 4.8 X 10
70	P0937070	SET SCREW M6-1 X 10
71	P0937071	ROLL PIN 3 X 14
72	P0937072	CLUTCH BRACKET
73	P0937073	CLUTCH
74	P0937074	KEY 3 X 3 X 22 RE
75	P0937075	GEAR SHAFT
76	P0937076	KEY 3 X 3 X 14 RE
77	P0937077	GEAR SHAFT BRACKET
78	P0937078	HEX NUT M5-.8
79	P0937079	SUPPORT PLATE

REF	PART #	DESCRIPTION
80	P0937080	FLAT WASHER 5MM
81	P0937081	CHANGE GEAR 72T
82	P0937082	CHANGE GEAR 19T
83	P0937083	CHANGE GEAR 76T
84	P0937084	CHANGE GEAR 24T
85	P0937085	GEAR SLEEVE
86	P0937086	GEAR SHAFT
87	P0937087	CAP SCREW M5-.8 X 8
88	P0937088	SPACER 10 X 17 X 8
89	P0937089	CHANGE GEAR 90T
90	P0937090	CAP SCREW M5-.8 X 25
91	P0937091	BED BASE
92	P0937092	CAP SCREW M6-1 X 35
93	P0937093	BED LOCK SHAFT
94	P0937094	BED LOCK SHAFT BRACKET
96	P0937096	CLUTCH KNOB
97	P0937097	DAM-BOARD
98	P0937098	CROSS-SLIDE LEADSCREW BRACKET
99	P0937099	CROSS-SLIDE LEADSCREW
100	P0937100	SADDLE
101	P0937101	CROSS-SLIDE NUT
102	P0937102	CROSS-SLIDE LEADSCREW NUT
103	P0937103	CROSS-SLIDE
104	P0937104	SET SCREW M4-.7 X 16
105	P0937105	HEX NUT M4-.7
106	P0937106	CROSS-SLIDE WEDGE
107	P0937107	GIB
108	P0937108	CAP SCREW M8-1.25 X 40
109	P0937109	TOOL REST
110	P0937110	TOOL REST SHAFT
111	P0937111	CONNECT BLOCK
112	P0937112	POTENTIOMETER WH24-1 4.7K
113	P0937113	EMERGENCY STOP SWITCH HONGBO LAS1-A
114	P0937114	FOR/REV SWITCH ZH-D
115	P0937115	POWER INDICATOR ZD7
116	P0937116	FUSE BOX BF021
117	P0937117	CIRCUIT BOARD XMT XMT1115
118	P0937118	LOCK CONNECT
119	P0937119	CIRCUIT BOARD BOX
120	P0937120	TAP SCREW M2.9 X 9.5
121	P0937121	MICRO SWITCH OM SS-5GL
122	P0937122	TAP SCREW M2.2 X 9.5
123	P0937123	POWER CORD 18G 3W 72" 5-15P
130	P0937130	SET SCREW M5-.8 X 20
131	P0937131	TIMING BELT 1.5 X 83 X 10
143	P0937143	FAULT INDICATOR ZD7
148	P0937148	PHLP HD SCR M4-.7 X 6
153	P0937153	TOOL REST BLOCK
193	P0937193	POWER SUPPLY SWITCH HY29D
194	P0937194	SPRING 1 X 12
195	P0937195	DIAL
218	P0937218	FLAT WASHER 4MM
219	P0937219	PULLEY WASHER
220	P0937220	TAILSTOCK CASTING
221	P0937221	TAILSTOCK BASE PLATE
223	P0937223	SET SCREW M6-1 X 20
224	P0937224	BEARING SLEEVE
250	P0937250	CAP SCREW M5-1 X 14
251	P0937251	FILTER
252	P0937252	SPACER 28 X 44 X 35
253	P0937253	CAP SCREW M8-1.25 X 25
254	P0937254	TAP SCREW M3 X 8
255	P0937255	LATHE CARBON BRUSH (2-PC SET)
256	P0937256	LATHE CARBON BRUSH COVER



Labels & Cosmetics

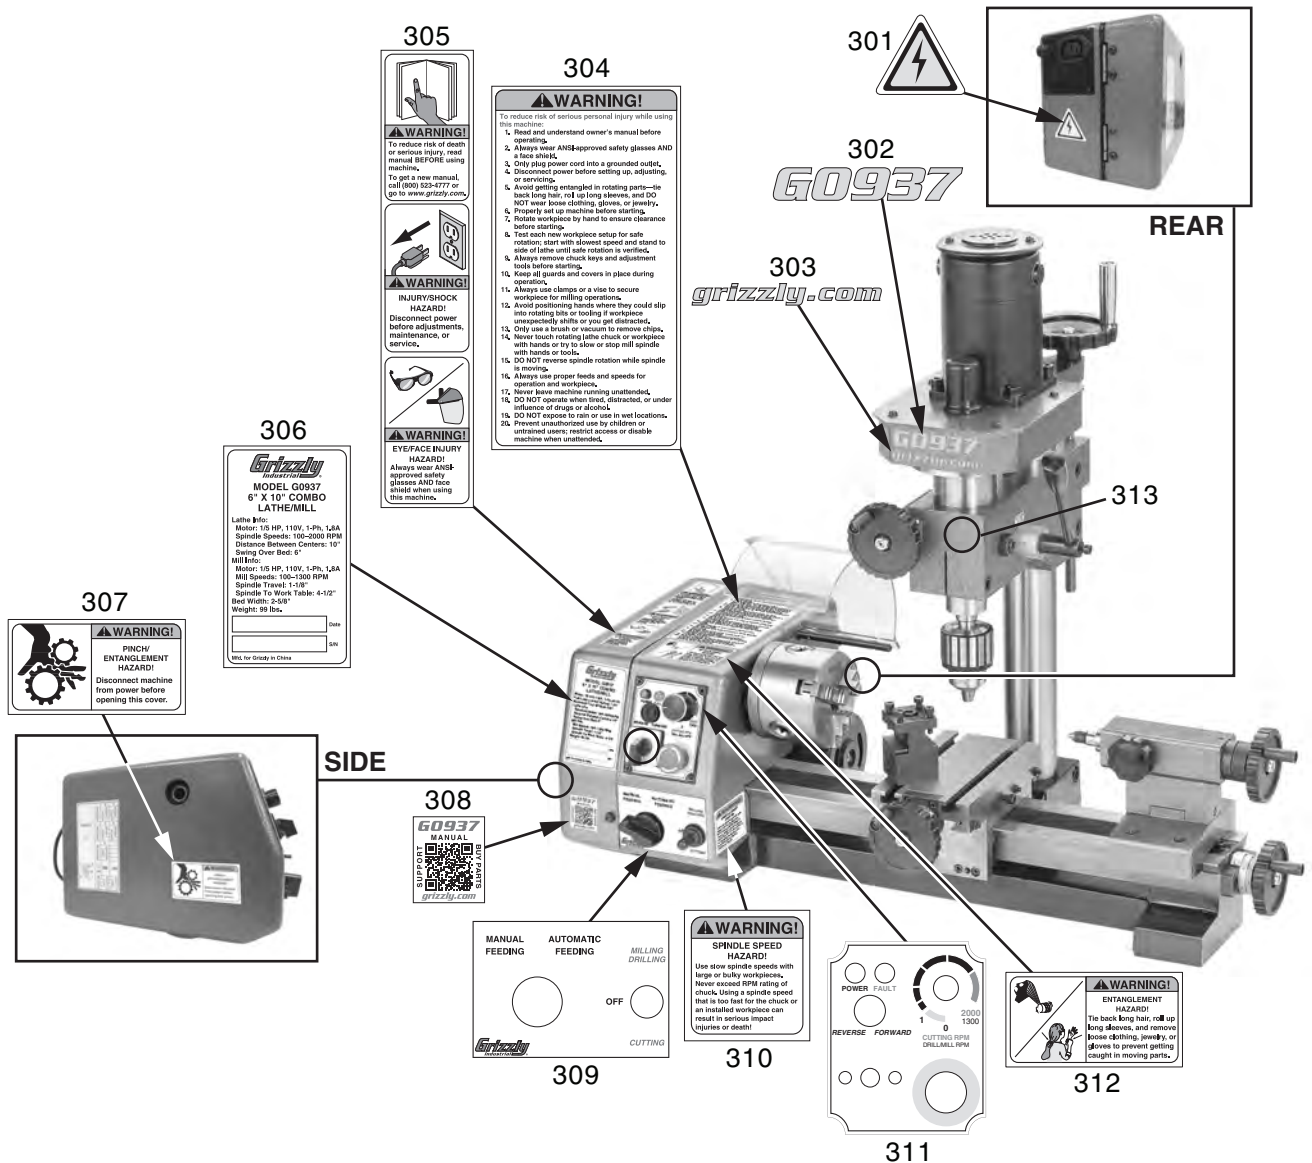

REF	PART #	DESCRIPTION
301	P0937301	ELECTRICITY LABEL
302	P0937302	MODEL NUMBER LABEL
303	P0937303	GRIZZLY.COM LABEL
304	P0937304	MACHINE WARNING LABEL
305	P0937305	MANUAL/DISCONNECT/PPE LABEL
306	P0937306	MACHINE ID LABEL
307	P0937307	PINCH/ENTANGLEMENT LABEL

REF	PART #	DESCRIPTION
308	P0937308	QR CODE LABEL
309	P0937309	MAN/AUTO FEED LABEL
310	P0937310	SPINDLE SPEED WARNING LABEL
311	P0937311	CONTROL PANEL LABEL
312	P0937312	ENTANGLEMENT LABEL
313	P0937313	TOUCH-UP PAINT, GRIZZLY GREEN

! WARNING

Safety labels help reduce the risk of serious injury caused by machine hazards. If any label comes off or becomes unreadable, the owner of this machine **MUST** replace it in the original location before resuming operations. For replacements, contact (800) 523-4777 or www.grizzly.com.

